


FOR AN EMERGENCY, CALL 911

HOLY TRINITY SCHOOL FIRE EMERGENCY ROUTE


745 6th Avenue South • South St. Paul, MN 55075



UPPER LEVEL

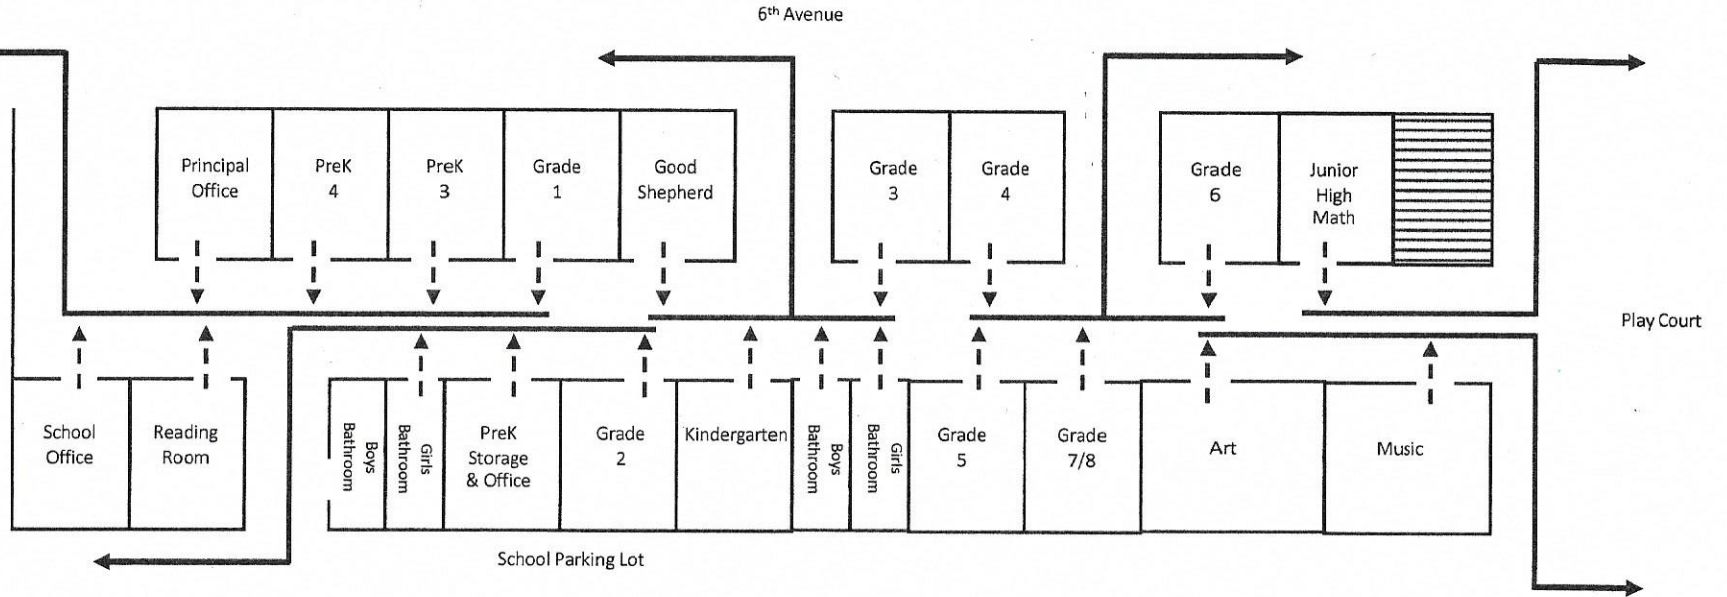

LOWER LEVEL

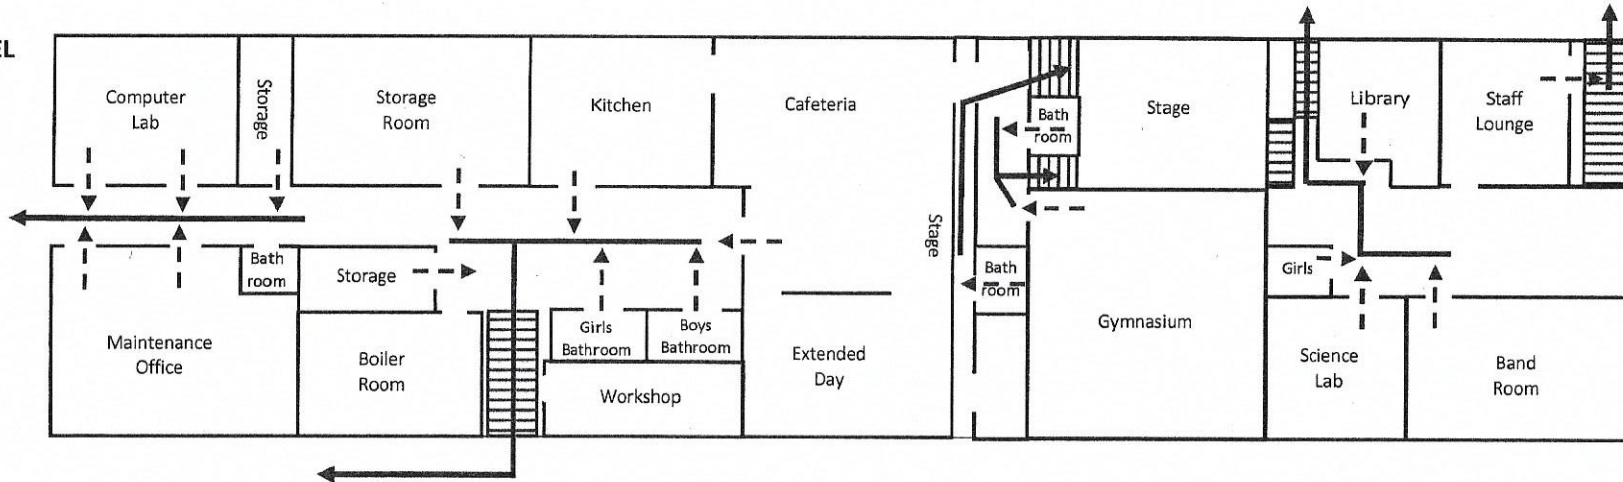

AHERA 6 Month Reinspection Report

1

Building Name: *Holy Trinity School*

Reinspection Date: *8-20-20*

Sample Number	Material Location	Material Description	Material Type ¹	Quantity In sq ft	Samples Collected	ACBM			Friable (Yes, No)	Condition ² (ND, D, SD)	Pot Dam PD PSD	Comments
						Positive	Negative	Assumed				
	<i>Maintenance Office</i>	<i>Performed Pipe Ins</i>	<i>(TSI) Surf Misc</i>	<i>60Ln</i>				<i>X</i>	<i>Yes</i>	<i>ND</i>	<i>PD</i>	
	<i>"</i>	<i>Performed Pipe Fitting Ins</i>	<i>(TSI) Surf Misc</i>	<i>8</i>				<i>X</i>	<i>Yes</i>	<i>ND</i>	<i>PD</i>	
<i>11</i>	<i>Millboarded once per house</i>	<i>Millboard Pipe Ins</i>	<i>TSI Surf Misc</i>	<i>30Ln</i>				<i>X</i>	<i>Yes</i>	<i>ND</i>	<i>PD</i>	
	<i>"</i>	<i>Millboard Pipe Fitting Ins</i>	<i>TSI Surf Misc</i>	<i>6</i>				<i>X</i>	<i>Yes</i>	<i>ND</i>	<i>PD</i>	
	<i>Stairwell and Storage</i>	<i>Millboard Pipe Ins</i>	<i>(TSI) Surf Misc</i>	<i>80Ln</i>								
	<i>Stairwell Storage</i>	<i>Millboard Pipe Fittings</i>	<i>(TSI) Surf Misc</i>	<i>35</i>								
	<i>Stairwell and Storage</i>	<i>Performed Pipe Ins</i>	<i>(TSI) Surf Misc</i>	<i>122m</i>								
	<i>Hallway to Kitchen</i>	<i>Millboard Pipe Ins</i>	<i>(TSI) Surf Misc</i>	<i>122m</i>								
	<i>"</i>	<i>Performed Pipe Ins</i>	<i>(TSI) Surf Misc</i>	<i>4Ln</i>								
	<i>Porter Rm</i>	<i>Bracing Ins</i>	<i>(TSI) Surf Misc</i>	<i>40Ln</i>						<i>ND</i>		
	<i>"</i>	<i>Studs Ins</i>	<i>(TSI) Surf Misc</i>	<i>110Ln</i>								
	<i>"</i>	<i>Millboard Pipe Fittings</i>	<i>(TSI) Surf Misc</i>	<i>55</i>								
	<i>"</i>	<i>Millboard Pipe Ins</i>	<i>(TSI) Surf Misc</i>	<i>250Ln</i>								
	<i>"</i>	<i>Performed Pipe Ins</i>	<i>(TSI) Surf Misc</i>	<i>25Ln</i>								
	<i>"</i>	<i>Performed Pipe Fitting Ins</i>	<i>(TSI) Surf Misc</i>	<i>4</i>								
		<i>Porter Ins</i>	<i>TSI Surf Misc</i>									
	<i>Fire Alarm Panel Room</i>	<i>Performed Pipe Ins</i>	<i>(TSI) Surf Misc</i>	<i>5Ln</i>						<i>ND</i>	<i>PD</i>	
<i>11</i>	<i>Millboard Pipe Ins</i>	<i>Millboard Pipe Ins</i>	<i>(TSI) Surf Misc</i>	<i>156m</i>						<i>ND</i>	<i>PD</i>	

1. TSI - Thermal Systems Insulation, S - Surfacing, M - Miscellaneous
 2. ND - No Damage, D - Damage, SD - Significant Damage

AHERA 6 Month Reinspection Report

Building Name:

Reinspection Date:

Sample Number	Material Location	Material Description	Material Type ¹	Quantity In sq ft	Samples Collected	ACBM			Friable (Yes, No)	Condition ² (ND, D, SD)	Pot Dam PD PSD	Comments
						Positive	Negative	Assumed				
	Waste Shop Electrical Room	Preformed Pipe Ins	TSI Surf Misc	35Ln						ND	AD	
	"	Preformed Pipe Fitting Ins	TSI Surf Misc	3								
	"	Millboard Pipe Ins	TSI Surf Misc	105Ln								
	"	Millboard Pipe Fitting Ins	TSI Surf Misc	17								
	Waste Shop Electrical Rm closet	Preformed	TSI Surf Misc	10								
	"	Millboard	TSI Surf Misc	30								
	"	Millboard Fitting	TSI Surf Misc	3								
	Kitchen	Preformed	TSI Surf Misc	30Ln								
	"	Millboard	TSI Surf Misc	130Ln								
	"	Millboard fittings	TSI Surf Misc	12								
	Kitchen Closet	Preformed	TSI Surf Misc	6								
	"	Preformed Fitting	TSI Surf Misc	1								
	"	Millboard	TSI Surf Misc	20								
	"	Millboard fitting	TSI Surf Misc	5								
	Cafeteria West	Preformed Pipe Ins	TSI Surf Misc	145Ln								
	"	Preformed Pipe Fitting	TSI Surf Misc	46								
	"	Millboard	TSI Surf Misc	90								
	"	Millboard Fitting	TSI Surf Misc	5								

1. TSI - Thermal Systems Insulation, S - Surfacing, M - Miscellaneous
 2. ND - No Damage, D - Damage, SD - Significant Damage

AHERA 6 Month Reinspection Report

3

Building Name:

Reinspection Date:

Sample Number	Material Location	Material Description	Material Type ¹	Quantity In sq ft	Samples Collected	ACBM			Friable (Yes, No)	Condition ² (ND, D, SD)	Pot Dam PD PSD	Comments
						Positive	Negative	Assumed				
	Cafeteria East	Preformed	(TSI) Surf Misc	150Ln						ND	PD	
		Preformed Fitting	(TSI) Surf Misc	35								
		mill board	(TSI) Surf Misc	210Ln								
		mill board Fitting	(TSI) Surf Misc	17								
	Cafeteria West/ East	1x1 CT symmetrical Holes	TSI Surf Misc	4500 sf								
	stage Storage West	Preformed Ins	(TSI) Surf Misc	20Ln								
	"	Preformed Fitting	(TSI) Surf Misc	8								
	"	mill board Ins	(TSI) Surf Misc	25Ln								
	"	mill board Pipe fittings	(TSI) Surf Misc	10								
	stage Storage North	Preformed pipe Ins	(TSI) Surf Misc	8Ln								
	"	Preformed pipe Fitting	(TSI) Surf Misc	2								
	"	mill board Pipe Ins	(TSI) Surf Misc	16Ln								
	"	mill board Pipe Fitting	(TSI) Surf Misc	6								
	Locker Rm stairwell	Preformed	(TSI) Surf Misc	8Ln								
	"	Preformed fitting Ins	(TSI) Surf Misc	1								
	"	mill board Pipe Ins	(TSI) Surf Misc	17Ln								
	"	mill board Pipe Fitting	(TSI) Surf Misc	8								
	Boys Locker Rm Hallway	Preformed Pipe Fitting Ins	(TSI) Surf Misc	4						-	PSD	River

1. TSI - Thermal Systems Insulation, S - Surfacing, M - Miscellaneous
 2. ND - No Damage, D - Damage, SD - Significant Damage

245
25
225
900

14
3
2
275
50/0
375

4

AHERA 6 Month Reinspection Report

Building Name:

Reinspection Date:

Sample Number	Material Location	Material Description	Material Type ¹	Quantity In sq ft	Samples Collected	ACBM			Friable (Yes, No)	Condition ² (ND, D, SD)	Pot Dam PD PSD	Comments
						Positive	Negative	Assumed				
	Boys Locker Rm Hallway	Preformed Pipe Ins	TSI Surf Misc	8Ln						ND	PSD	PD
	"	Millboard Pipe Fitting Ins	TSI Surf Misc	20Ln						ND	PSD	
	Boys II Locker Room	millboard Pipe Ins	TSI Surf Misc	2						ND	PSD	
	"	Preformed Pipe Ins	TSI Surf Misc	20Ln						ND	PSD	
	"	Preformed Pipe Fitting	TSI Surf Misc	2						ND	PSD	
	"	millboard Pipe Ins	TSI Surf Misc	70Ln						ND	PSD	
	"	millboard Pipe Fitting Ins	TSI Surf Misc	12						ND	PSD	
	Girls Locker Room	millboard Pipe Ins	TSI Surf Misc	36Ln						ND	PSD	
	"	millboard Pipe Fitting Ins	TSI Surf Misc	8						ND	PSD	
	Outside Girls Locker Room	9x9 FT tan/brown	TSI Surf Misc	255F								
	Stope (Gym)	Tan/Brown	TSI Surf Misc	1125F								PD
	"	Preformed Pipe Ins	TSI Surf Misc	95Ln								PD
	"	Preformed Pipe Fitting	TSI Surf Misc	22								PD
		millboard	TSI Surf Misc									
		millboard	TSI Surf Misc									
	Gym	9x9 FT Tan w/ BRN	TSI Surf Misc	3150								PD
	"	Preformed Pipe Ins	TSI Surf Misc	260Ln								PD
	"	Preformed Fitting Ins	TSI Surf Misc	25								PD

1. TSI - Thermal Systems Insulation, S - Surfacing, M - Miscellaneous
 2. ND - No Damage, D - Damage, SD - Significant Damage

25
30
00
75

Ceiling spray on Ins. Science Room/Corridor/Library

5

AHERA 6 Month Reinspection Report

Building Name:

Reinspection Date:

Sample Number	Material Location	Material Description	Material Type ¹	Quantity In sq ft	Samples Collected	ACBM			Friable (Yes, No)	Condition ² (ND, D, SD)	Pot Dam PD PSD	Comments
						Positive	Negative	Assumed				
	Gym Storage (South)	Millboard Pipe Ins	TSI Surf Misc	10 Ln						ND	PD	
		Millboard Pipe Fitting	TSI Surf Misc	3							PD	
	Gym Office	9x9 FT Ton w/Brn	TSI Surf Misc	30 SF								under wood floor
	Gym Stairwell North Ramp	"	TSI Surf Misc	45 SF							PD	
	Library Corridor from Stairwell	"	TSI Surf Misc	250 SF								
	Science Lab	"	TSI Surf Misc	850 SF							PD	
	"	Millboard Pipe Fittings	TSI Surf Misc	8							PD	
	"	Preformed Pipe fitting	TSI Surf Misc	2								
	Library	9x9 FT Ton w/Brn	TSI Surf Misc	500 SF								under Carpet
	"	Pipe Fittings on fiberglass	TSI Surf Misc	13							PD	
	Staff Lounge hallway	9x9 FT Ton w/Brn	TSI Surf Misc	250 SF								
	Staff Lounge	9x9 FT Ton w/Brn	TSI Surf Misc	500 SF								under Carpet
	Staff Lounge	Pipe Fittings on fiberglass	TSI Surf Misc	7							PD	
	North Stairwell	9x9 FT Ton w/Brn	TSI Surf Misc	50 SF								
	"	Pipe Fittings on fiberglass	TSI Surf Misc	13							PD	
	Band Rm	"	TSI Surf Misc	24							PD	
	"	9x9 FT Ton w/Brn	TSI Surf Misc	500 SF								under Carpet
			TSI Surf Misc	Upper Level								

↓

1. TSI - Thermal Systems Insulation, S - Surfacing, M - Miscellaneous
 2. ND - No Damage, D - Damage, SD - Significant Damage

25
22/00
50

AHERA 6 Month Reinspection Report

22
32
44
66
204

6

Upper Level

Building Name:

Reinspection Date:

Sample Number	Material Location	Material Description	Material Type ¹	Quantity In sq ft	Samples Collected	ACBM			Friable (Yes, No)	Condition ² (ND, D, SD)	Pot Dam PD PSD	Comments
						Positive	Negative	Assumed				
	Music Room 16	9x9 FT	TSI Surf (Misc)	700 SF						ND		under carpet
	Room 15	u	TSI Surf (Misc)	700 SF								u
	Room 14	u	TSI Surf (Misc)	700 SF								u
	Room 13	u	TSI Surf (Misc)	700 SF								u
	Room 12	M	TSI Surf Misc	700 SF								u
	Room 11	9x9 FT Gray and Green	TSI Surf (Misc)	700 SF								
	Room 10	9x9 FT Red and Tan	TSI Surf (Misc)	700 SF								
	Stall way storage next to Rm 16	9x9 FT Tan w/ Brn	TSI Surf (Misc)	50 SF								2 storage Rm 5
	Storage Across From Rm 9	9x9 FT Tan w/ Brn	TSI Surf (Misc)	125 SF								
	Room 9	9x9 FT Tan and Green	TSI Surf (Misc)	700 SF								
	Room 8	9x9 FT Brown and Tan	TSI Surf (Misc)	550 SF								
	Room 7	9x9 FT Gray and Green	TSI Surf (Misc)	550 SF								
	Room 6	9x9 FT Red and Tan	TSI Surf (Misc)	550 SF								
	Room 5	9x9 FT Green and Tan	TSI Surf (Misc)	550 SF								
	Room 4	9x9 FT Brown and Tan	TSI Surf (Misc)	550 SF								
	Room 3	9x9 FT Green and Brown	TSI Surf (Misc)	550 SF								
#2	Room 1	9x9 FT Green and Tan	TSI Surf (Misc)	550 SF								
	Main office	9x9 FT	TSI Surf (Misc)	300 SF								under carpet

1. TSI - Thermal Systems Insulation, S - Surfacing, M - Miscellaneous
 2. ND - No Damage, D - Damage, SD - Significant Damage